

LANDAU BOATS, INC.

(Lebanon, MO)(971531S)

Year: 1995 - 1997

Models: Crappie 150

Units: 135

Problem: Level Flotation

LOGIC MARINE CORP.

(Durham, NC)(961495S)

Year: 1995 - 1996

Models: Logicraft 2.7 and Logicraft 9
with HINs 124 and below
LogiCraft 3.6 and Logicraft 12
with HINs 320 and below
Logic V15 with HINs 120 or below

Units: 280

Problem: Level Flotation

MASTERCRAFT BOAT COMPANY

(Vonore, TN)(950282T)

Year: 1994 - 1995

Models: Maristar 200 VRS

Units: 318

Problem: Chafing of fuel tank may cause leakage;
possible fire/explosion if ignition source present

MASTERCRAFT BOAT COMPANY

(Vonore, TN)(990151T)

Year: 1999

Models: Maristar 205V, ProStar 205 V & X-Star

Units: 554

Problem: Possible friction between fuel tank and
shaft coupler may damage fuel tank; possible fire
or explosion if ignition source present

MERCURY MARINE

(Fond du Lac, WI)(980044T)

Year: 1997 & 1998

Models: Sport Jet 175XR2 pump units with serial
numbers: OE151580 through OE289626

Units: 4,396

Problem: Nozzle assembly screws may lose clamp
load; possible loss of steering control

MERCURY MARINE

(Fond du Lac, WI)(980158T)

Year: 1998

Models: Mercury & Mariner 15 (4 strokes) with
serial nos.: 0G590000 - 0G736819

Units: 4,355

Problem: Reverse lock link rod defective;
potential unexpected boat stoppage

MERCURY MARINE**QUICKSILVER ACCESSORIES DIV.**

(Fond du Lac, WI)(990037T)

Models: Galvanic isolators (Part No. 18478A 2)
sold as Quicksilver accessories shipped between
November 1998 and February 12, 1999. The
units have a four character Julian date code that
indicates the date the unit was manufactured. The
first three characters identify the day of the year,
and the fourth character is the last digit in the year
(therefore, 3028 indicates the 302nd day of 1998,
and 0409 indicates the 40th day of 1999). Any
galvanic isolators with date codes between 3028
and 0409 should be returned to the manufacturer
immediately.

Units: 1,117

Problem: Improper diode in galvanic isolator
may cause failure of grounding function;
possibility of fire or electrical charge transmission
throughout boat or into water around the boat

MERCURY MARINE

(Fond Du Lac, WI)(940307T)

Year: 1994

Model: Mercury High Performance MCM V-8
sterndrives with 2 BBL carburetors with
serial numbers: OF213347 to OF374181
MerCruiser MCM V-6 and V-8
stern drives with serial numbers:
OF353000 to OF421726
MerCruiser MIE V-8 Ski and inboard
engines with serial numbers:
OD798385 to OF419755

Units: 27,999

Problem: Fuel filter susceptible to corrosion and
could cause fuel leak; possible fire/explosion if
ignition source present

MERCURY MARINE

(Fond du Lac, WI)(990173T)

Year: 1998 and 1999

Models: Mercury & Mariner 225/250 HP,
3.0 Litre (Carb/EFI)
XL, CXL, XXL and CXXL
3.0 Litre (OptiMax)
XL, CXL, XXL and CXXL
with serial nos.: 0G644802 thru 0G870075

Units: 6,830

Problem: Steering arm attaching bolt may fail;
possible loss of steering control

MERCURY MARINE

(Fond du Lac, WI)(970059T)

Year: 1997

Models: 2 barrel carbureted stern drive engines:
MCM 3.0LX with serial nos:
OKO37386 - OK155525
MCM 4.3LX with serial nos:
OKO24742 - OKO24773 and
OKO38575 - OK156789
MCM 5.7L with serial nos:
OKO24816 - OKO24967 and
OKO38516 - OK156871

Units: 5,975

Problem: Potentially defective backfire flame
arrester; possible fire/explosion if fuel/vapor
source present

MERCURY MARINE

(Fond du Lac, WI)(980159T)

Models: 1998 15 (4-Stroke) Mercury/Mariner
outboards w/ serial nos.:

0G590000 - 0F737315

1999 9.9/15 (4-Stroke) Mercury/Mariner
outboards w/ serial nos.:

0G765003 - 0G772553

Units: 5,039

Problem: Motor mounts could separate; engine
might fall off boat

MERCURY MARINE

(Fond du Lac WI)(960077T)

Year: 1994 and 1995

Models: Commander 3000 remote controls

Units: 129,839

Problem: Improperly hardened gear in
Commander 3000 remote controls built between
June 1, 1994 and September 1, 1995 could fail;
possible loss of throttle and/or shift control

MERCURY MARINE

(Fond du Lac, WI)(980122T)

Year: 1998

Models: 20/25 (2-Stroke) & 20 Jet outboards with
serial nos.: 0G683156 - 0G686362

Units: 1,376

Problem: Possible loss of flywheel; danger of
personal injury

OUTBOARD MARINE CORP.

(Waukegan, IL)(980020T)

Year: 1998

Models: Johnson & Evinrude Crossflow
V4 outboards:
90TSLEC, 115TSLEC, 115HLEC,
115TSXEC, 115HXEC

Units: 1,942

Problem: Use of incorrect steering connector kit
may cause excessive wear on steering system
components

OUTBOARD MARINE CORP.

(Waukegan, IL)(960042T)

Year: 1996

Models: Johnson and Evinrude outboard motors
equipped with electric start

Units: 36,669

Problem: Potentially defective engine stop switch;
engine might not stop if operator ejected

PREMIER MARINE

(Wyoming, MN)(950217T)

Year: 1994 & 1995

Models: All pontoon boat models manufactured between Oct. 1, 1994 and July 31, 1995 equipped with built in fuel tanks

Units: 370

Problem: Attwood Fuel Fill Recall

PRO-LINE BOATS

(Crystal River, FL)(950219T)

Year: 1995 & 1996

Models: 192-S with HINs:

PLCST025J495 - PLCST060F595

201-S with HINs:

PLCWC002A595 - PLCWC049G595

210-S with HINs:

PLCSA033J495 - PLCSA005G596

240-S with HINs:

PLCSG028J495 - PLCSG038H596

251-W with HINs:

PLCWA021J495 - PLCWA030H596

Units: 774

Problem: Attwood Fuel Fill Recall

PRO-LINE BOATS

(Crystal River, FL)(980233T)

Year: 1997 - 1999

Models: 1997: 2810 W/A, 2700 Sport, 251 W/A

1998: MM2810W/A, SJ2700 Sport,

WA251 W/A, WW2610 W/A

1999: MM2810 - W/A, SJ2700 - Sport,

WA251 - W/A, 2610 W/A

Units: 651

Problem Sea Land sani pump used to drain cockpit deck fish boxes may have a circuit board subject to corrosion/short circuit

PURSUIT FISHING BOATS DIV. OF TIARA YACHTS

(Ft. Pierce, FL)(980041T)

Year: 1995 - 1997

Models: 2870 Offshore & 2870 Walkaround

Units: 185

Problem: Novatron 110 V shore power units wired incorrectly; possible shock hazard

RANGER BOATS

(Flippin, AR)(950163T)

Year: 1995 & 1996

Models: Rebel 158, Rebel 1585, 397S, 397XT, 461S

Units: 556

Problem: Attwood Fuel Fill Recall

REGAL MARINE INDUSTRIES

(Orlando FL)(940247T)

Year: (see below)

Models: Commodore 290/300 with hull nos.: JJ011 through JJ178

Units: 167

Problem: Hull to deck joint separation between swim platform and sheerline; under some conditions hull leakage may occur

REGAL MARINE INDUSTRIES

(Orlando, FL)(950223T)

Year: 1996

Models: 182 with HINs:

RGMA B547F596 - RGMA B610H596

176 with HINs:

RGMA S988F596 - RGMA S999F596

176 with HINs:

RGMA T011F596 - RGMA T081H596

202 with HINs:

RGMA B C032F596 - RGMA B C079H596

202 with HINs:

RGMA B E226F596 - RGMA B E236H596

222 with HINs:

RGMA D A212G596 - RGMA D A215H596

222 with HINs:

RGMA D P074F596 - RGMA D P076H596

222 with HIN: RGMDE095F596

Units: 199

Problem: Attwood Fuel Fill Recall

RIVIERA CRUISER

(Columbia City, IN)(990117S)

Year: 1999

Models: Pontoon Boats equipped with built-in
Fikes

Plastics Fuel Tanks w/ serial nos:
904001 - 905159

Units: 97

Problem: Fuel tank leakage; possible fire or
explosion if ignition source present

SEA RAY BOATS

(Knoxville, TN)(970080T)

Year: 1997

Models: 190BR & 210BR

Units: 1,259

Problem: Abrasion of fuel vent line by alternator;
possible fire/explosion if ignition source present

SEASWIRL BOATS

(Waukegan, IL) (970108S)

Year: 1992 - 1997

Models: 182CC O/B w/ HINs:

BRCJ001AH293 - BRCJ086BF494
1730 CC O/B w/ HINs:

BRCJ001CH495 - BRCJ046EA797

1850CC O/B w/ HINs:

BRCP001DG596 - BRCP024DK697

1850DC O/B w/ HINs:

BRCK001DG596 - BRCK072EB797

200WA O/B w/ HINs:

BRCS001AH495 - BRCS198AG595

1850WA O/B w/ HINs:

BRCS001BG596 - BRCS062CB797

180BR I/O (V6 & V8) w/ HINs:

BRCD001BH394 - BRC0156BB797

188 SPYDER I/O w/ HINs:

BRCX001AH192 - BRCX200CF494

198 SPYDER I/O w/ HINs:

BRCX002DH495 - BRCX016FA797

Units: 2,190

Problem: Insufficient flotation

SKI CENTURION DIV. OF FINELINE INDUSTRIES, INC.

(Merced, CA)(970084T)

Year: 1997

Models: Ski Centurion: Elite Lapoint,
Elite Bowrider, Elite V Drive,
Falcon Sport, Sport Bowrider, Wave,
Pro Am, Pro Am Closed Bow
Ski Supreme: 210 Medalist,
Competition Series, V-Drive

Units: 154

Problem: Potentially defective rudder may break;
possible loss of steering control

SMOKER CRAFT

(New Paris, IN)(961478S)

Year: 1995 - 1996

Models: 17' Northwood Pro Tourney

Units: 190

Problem: Maximum weight and maximum persons
capacities overrated; Level Flotation

STARCRAFT MARINE LLC

(Topeka, IN)(980210T)

Year: 1999

Models: Seville 240, Seville 241, Stardeck 200 E,
Stardeck 240 E, Stardeck 241 E,
Stardeck 261 E

Units: 106

Problem: Aqua Signal blue navigation lights
conflict with Navigation Rules; increased danger
of collision

STARCRAFT MARINE LLC

(Topeka, IN)(990017S)

Year: 1999

Models: Aurora 2000, Aurora 2015, Aurora 2415,
Sun Lounger 200, Sun Lounger 205,
Sun Lounger 245

Units: 104

Problem: All-round navigation light fails to
display 360° visibility with canvas top installed;
increased danger of collision

STRATOS BOATS

(Old Hickory, TN)(950127T)

Year: 1995 & 1996

Models: 1600 Sportsman, 1700 Sportsman,
1900 Sportsman, 2100 Sportsman,
Hydra Sports 16 Skiff,
Hydra Sports 17 Skiff,
Hydra Sports 19 Skiff,
Hydra Sports 21 Skiff,
Quest 160 CC, Quest 170 CC,
Quest 190 CC, Quest 220 CC

Units: 154

Problem: Attwood Fuel Fill Recall

SUGAR SAND MARINE

(Fargo, ND)(940224T)

Year: 1994

Models: Mirages equipped with Mercury
Sport Jet 90

Units: 182

Problem: Missing ignition-protection of positive
battery cable connection at starter solenoid
terminal; possible fire/explosion if fuel or vapor
source present

TIARA YACHTS

(Holland, MI)(980003S)

Year: 1997 & 1998

Models: 2900 Coronet, 3500 Open, 3500 Express
&

3400 Express w/ gas engines

Units: 60

Problem: Non-ignition protected circuit breakers
in areas open to engineroom; possible fire/
explosion if fuel or vapor source present

TRACKER MARINE

(Springfield, MO)(990157T)

Year: 1999 and 2000

Models: MH 170 w/ HINs:
BUJ35957F900 - BUJ40702H900
MH 180 w/ HINs:
BUJ19949B999 - BUJ40703H900

Units: 188

Problem: Bow structure may crack in rough water
conditions; possibility of flooding

TRACKER MARINE L.P.

(Springfield, MO)(940141T)

Year: 1994

Models: Pro 18 equipped with Mercury Sport Jet
90

Units: 223

Problem: Missing ignition-protection of positive
battery cable connection at starter solenoid
terminal; possible fire/explosion if fuel source
present

TRACKER MARINE L.P.

(Springfield, MO)(961490S)

Year: 1996

Models: Super GV14T with HINs:
BUJ16639H596 - BUJ36157E696

Units: 87

Problem: Level Flotation

TRACKER MARINE L.P.

(Springfield, MO)(980078T)

Year: 1998

Models: Tahoe Q5S with HINs:
BUJ72128I798 - BUJ91457D898

Units: 132

Problem: Fuel fill hose abrasion may cause fuel
leakage; possible fire/explosion if ignition source
present

VOLVO PENTA OF THE AMERICAS, INC.

(Chesapeake, VA)(980145T)

Year: 1997

Models: BY engines w/ serial nos.:
4110155491 - 4110159682

Units: 2,000

Problem: Improperly machined fuel pump inlet
fitting may cause fuel leakage; possible fire/
explosion if ignition source present

W.E. CONNERY BOAT BUILDER

(Cape Coral, FL)(941332S)

Year: 1995

Models: Flats King

Units: 12

Problem: Level Flotation